

# Manhole Inspection Summary

Manhole # S33EE\_004MH

Printed On: 12/17/2008

Page 1 of 3

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **33EE** Node: **004** Status: **Found**

Insp Date: **2/27/07 1:10 PM**

Incomplete Comments

Crew: **IB, FW**  
Inspector: **Bailey, I**  
Firm: **PER**

**Location** Address: **1020 PARK AVE**

Cross Street: **MARTIN LUTHER KING JR BLVD**

**Manhole** Type: **Inline** Location: **Grass** Ground Conditions: **Dry**  
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **The O12 pipe seal is not flush to the pipe.**

**Cover** Shape: **Circular** Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **0** (in.)  
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**  
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **7** (in.) Condition: ☒ Sound ☐ Cracked ☒ **Leaks**

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **7** (in.)  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated  
Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

**Corbel** Material: **Precast Concrete** ☐ Parged Type: **Concentric/Eccentric**  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated  
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Precast Concrete** ☐ Parged  
Shape: **Circular** Diameter: **48** (in.) Length: (in.)  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated  
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged ☐ Debris (not Condition related)  
Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps** Count: **13** Missing: **0** ☒ **Corroded**

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S33EE\_004MH


Printed On: 12/17/2008

Page 2 of 3

Location View



Top View

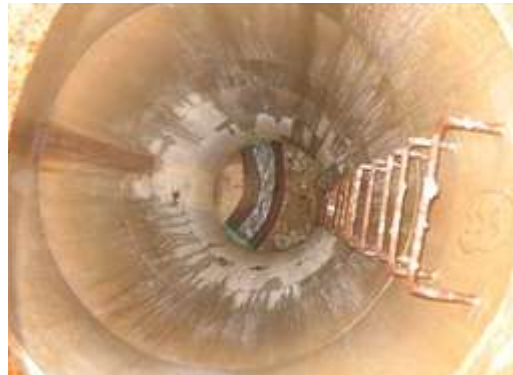

Corroded steps. Bench debris.

Defect



Frame offset. Adjustment infiltration.

Defect



Frame offset. Adjustment infiltration.

## Manhole Inspection Summary

Manhole # S33EE\_004MH

Printed On: 12/17/2008

Page 3 of 3

### 8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **PVC** ☐ Pipe Lined

Invert Depth: **20.15** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer Pipe In @ 7 O'Clock



Rod and Bar (Angled)

Pipe Material: **PVC** ☐ Pipe Lined

Invert Depth: **20.02** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection